



INSTRUCTION BULLETIN

No. 9016098
Machine: M17 / T17
Published: 12-2017
Rev. 00

NOTE: DO NOT DISCARD the Parts List from the Instruction Bulletin. Place the Parts List in the appropriate place in the machine manual for future reference. Retaining the Parts List will make it easier to reorder individual parts and will save the cost of ordering an entire kit.

NOTE: Numbers in parenthesis () are reference numbers for parts listed in Bill of Materials.

Installation instructions for **kit number 9016099**


SYNOPSIS:

This kit contains instructions to convert the 36VDC/160A off board charger from 480 vac to 400 vac for M17 / T17 machines.

Please follow step-by-step instructions.

SPECIAL TOOLS / CONSIDERATIONS: NONE

(Estimated time to complete: 15 minutes)

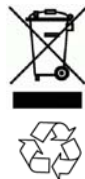

PROTECT THE ENVIRONMENT

Please dispose of packaging materials, used machine components such as batteries and fluids in an environmentally safe way according to local waste disposal regulations.

Always remember to recycle.


1. Press and hold the Enter / Power button on the battery charger to power it up.



2. Press and hold the ESC (Escape) button to enter the screen.



3. Press the four outer buttons as needed to navigate through screens in the following steps.

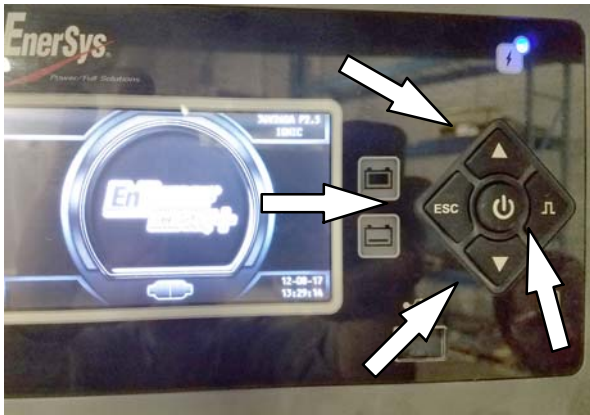


4. Navigate to "Password" then press the Enter/Power button. Enter the password 0 0 9 9 then Enter.




5. Navigate to "Settings" then Enter.



6. Navigate to "Power Supply" then Enter.

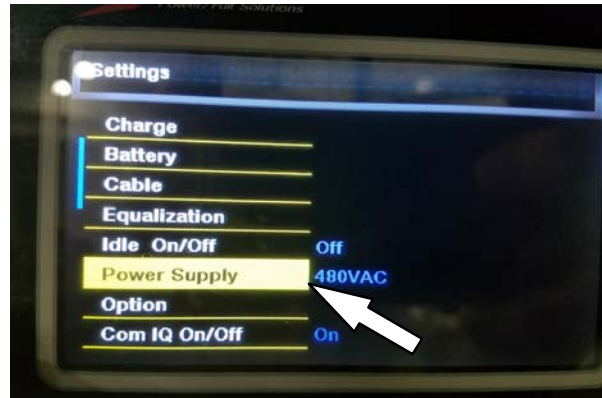

7. Select "400VAC" then Enter.

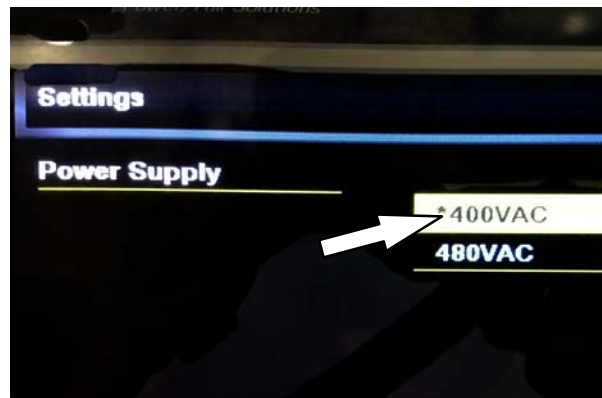

8. Press the ESC button to verify the correct setting was selected. An asterisk (*) will show next to active setting (*400VAC).

9. Press ESC then navigate to the "Exit" setting and select it.

10. The charger is now set to charge 400VAC batteries.